TELEPHONE SETS — 1702B CONNECTIONS

TABLE A

LINE AND RINGER CONNECTIONS

				Tip Party (Note 1 and 2)		
Wire or Lead		Individual or	Ring	No	Identifying Ground	
		Bridged	Pty	Ident. GRD	1000 ohms	2650 ohms
Inside Wire at Conn. Block	Ring	R	R	R	R	R
	Tip	G	G	G	G	G
	GRD	Y	Y	Y	Y	Y
Dial Light Transformer	1	Y	Y	Y	Y	Y
	2	В	В	В	В	В
	R	R	R	G	G	G
Mtg. Cord	G	G	G	R	R	R
at Conn. Block	Y	G	Y	Y	Y	Y
	BK	В	В	В	В	В
	W	Y	Y	Y	Y	Y
Ringer Leads	R	K	K	K	K	K
	BK	G	G	G	G	G
	S	*	*	*	В	*
	S-R	*	*	*	*	В
Switchhook	S-BR	C	С	F	F	F
Leads	S-W	F	F	С	C	C

TABLE B
RINGER LEAD CONNECTIONS TO
SILENCE RINGER PERMANENTLY


Tip Party	Ringer Leads			
Ident GRD	R	ВК	S	S-R
1000 ohms	В	G	В	*
2650 ohms	В	G	*	В

Note: Move (R) ringer lead from K to G on network for all classes of service except those listed above.

Note 1: For 1000 or 2650 ohm identifying ground, remove S-BK from A of network, insulate and store.

Note 2: Sets are shop wired for bridged or ring party. For tip party with or without identifying ground, see Table A.

* Insulated and stored.

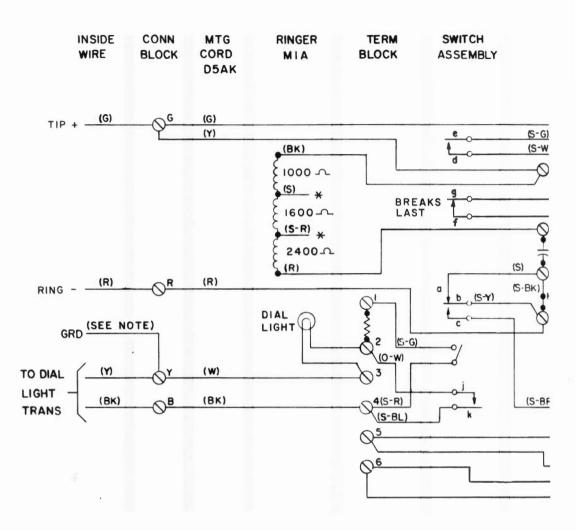

Not if n nece ligh

DIAL

25H4 G3AR 4010B (G) **○**RR (BK) (S-BK) (R-G) (S-R) K RCVR XMTR (W) L2 (O-BK) (BK) (BL) (W) (R) (R)


HANDSET

e: Ground may be omitted ot required for service. Not essary for protection of dial t transformer.

NETWORK

isulated and stored.

Fig. 1 - 1702B Telephone Set

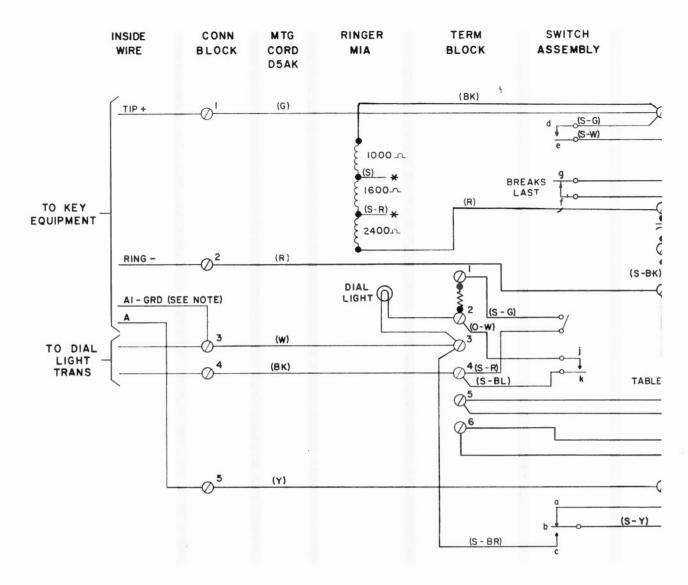

Wire o Lead Switchho Ringe Place M Cord or S

M

NETWORK 4010B HANDSET G3AR DIAL 25H4

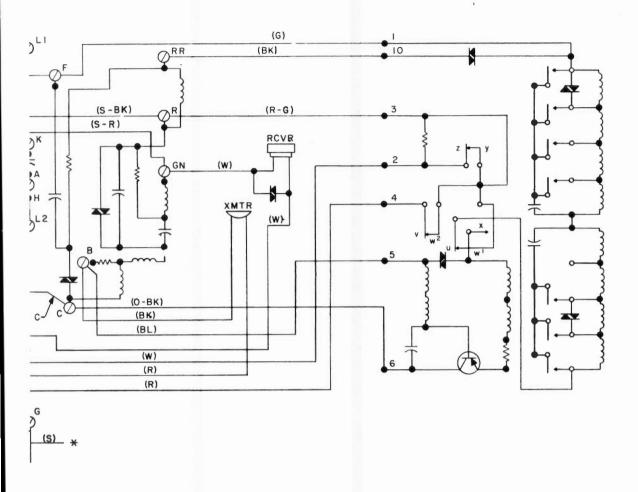


TABLE C
ODIFICATIONS FOR USE
IAI AND 1A2 KEY SYSTEMS

r	Color	From	То	
	S-Y	L2	G	
ook	S-BR	С	3	
	S	A	*	
r	BK	G	L1	
1W trap		L2	С	

Note: Ground may be omitted if not required for service. Not necessary for protection of dial light transformer.

* Insulated and stored.

Fig. 2—1702B Telephone Set, Connections for 1A1 and 1A2 Key Telephone System