

SERVICE 500C/D TELEPHONE SETS

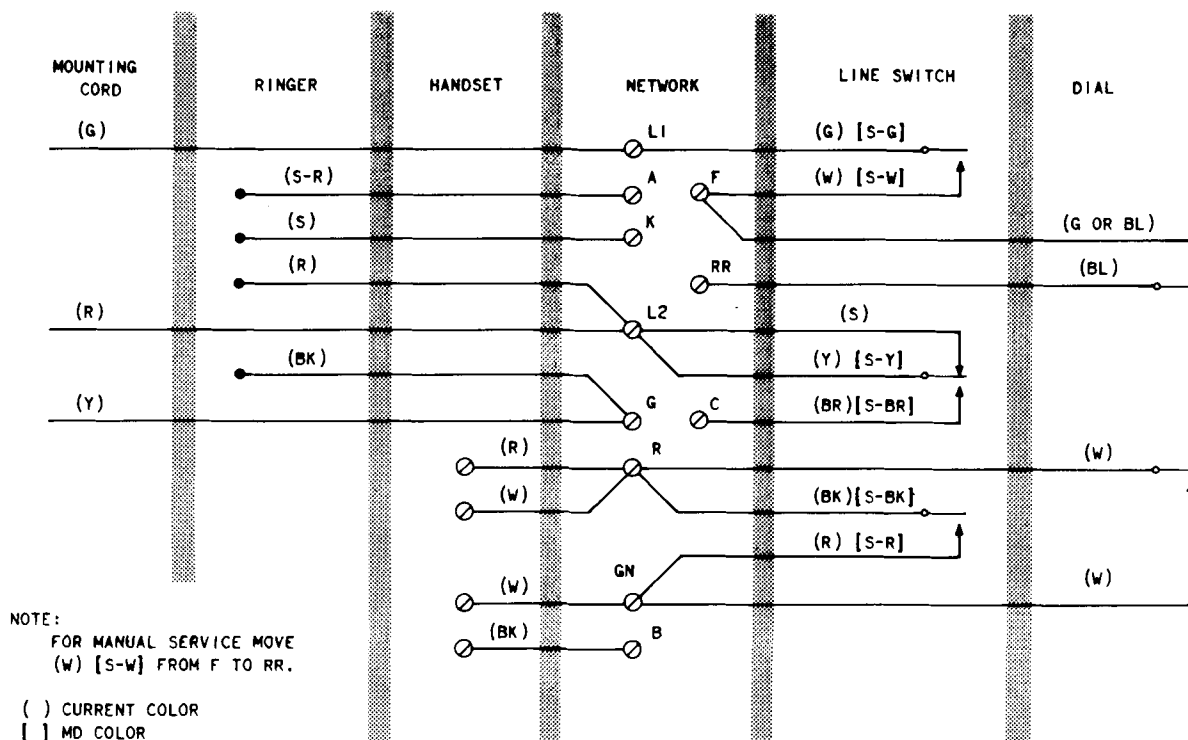


Fig. 1—500C/D Telephone Set, Connections

TABLE A
500C/D TELEPHONE SET, CONNECTIONS

WIRE OR LEAD		COLOR	INDIV OR BRIDGED	RING PARTY	TIP PARTY NO IDENT GRD	TIP PARTY IDENT	
						1000 Ω	2650 Ω
Ringer Leads		R	L2	L2	L2	K	B
		BK	G	G	G	G	B
		S	K	K	K	B	K
		S-R	A	A	A	B	G
Line Switch		S	L2	L2	L2	A	A
Mounting Cord in Set		R	L2	L2	L2	L2	L2
		G	L1	L1	L1	L1	L1
		Y	G	G	G	G	G
Mounting Cord at Connecting Block		R	R	R	G	G	G
		G	G	G	R	R	R
		Y	G	Y	Y	Y	Y
Line Wire at Connecting Block	Ring Tip Grd	R	R	R	R	R	R
		G	G	G	G	G	G
		Y	Y	Y	Y	Y	Y

Note: To silence ringer permanently:

- (a) For all classes of service except tip party identification ground; remove the (R) ringer lead from *L2* of network and insulate and store.
- (b) For tip party with 1000 ohms identification ground; remove (R) ringer lead from *K* of network and insulate and store.
- (c) For tip party with 2650 ohms identification ground; remove the (S) ringer lead from *K* of network and insulate and store.