COIN TRUNK CIRCUIT SD-32539-01 ARRANGED FOR COIN FIRST SERVICE OPERATION TESTS

USING TEST SET SD-31858-01 (J34701A)

STEP-BY-STEP SYSTEMS

1. GENERAL P			PAGE
	es a method of testing ees of the coin trunk oin first service, using	the coin trunk while under a leak condition.	8
test set SD-31858-01 (J3470 this section was formerly 226-521-501.		D. Operator Cut-Through and Ringback: This test checks the metallic cut-through over which the operator controls the coin and also the	
1.02 This section is reissued for the following reasons:		feature that provides the operator with a means of holding a trunk and ringing back through it.	9
(a) To revise paragraph 1.		-	
about sleeve identification when performing Test D in offices equipped with ANI.		E. Stuck-Coin Alarm Test: This test checks that the stuck-coin alarm feature of the coin trunk functions	
(b) To add Test G for testing the 12-second disconnect feature (option ZF).		satisfactorily.	11
This issue affects the Equipment Test List.		F. Coin-Trunk-Timed-Release Circuit Test (SD-31861-01): This	
1.03 The tests covered ar	թ.	test checks that the coin-trunk-timed-release condition is applied.	12
ine result covered at	PAGE	condition is applied.	12
A. Coin Collect—Loc checks the coin coll the coin trunk while under	ect features of a loop condition.	G. \$12-Second Forced Disconnect Feature (Option ZF): This test checks the 12-second forced disconnect feature (option ZF) which disconnects the switch train within 12 seconds when the called party disconnects but coin	
B. Coin Collect— Connector Tes	t Line SD-	station remains off-hook.	14
31857-01, Fig. 3 (9) This test checks the coin of the coin trunk while condition.	collect features	1.04 These tests should preferably be made periods of light traffic, and the perfo of Test D should be coordinated with the responsible for operator services.	rmance
C. Coin Return—Lea		1.05 During Test D, when testing to a office, and automatic number identity	

NOTICE

Not for use or disclosure outside the Bell System except under written agreement

SECTION 226-521-507

- (ANI) equipment is provided in the testing office, a ▶sleeve identification will have to be provided to prevent second trial transverter failure registrations. ▶(See Fig. 1 for example of providing this sleeve identification)
- 1.06 When testing coin trunks equipped with coin-trunk-release circuit (SD-31861-01), test each trunk in accordance with procedures of Test E; then test each trunk in accordance with procedures of Test F.
- 1.07 During Test E, the check of the coin-trunk-timed-release circuit register, if provided, will cause the register to advance. The reporting of this register operation should be in accordance with local instructions.
- 1.08 When making the coin-trunk-timed-release circuit (SD-31861-01) ineffective in an office arranged for extending alarms to another office, operate audible alarm switch or key to position where audible alarm will be heard. For offices not arranged for extending alarms, at coin-trunk-timed-release circuit (SD-31861-01), turn CO key to a position where GD lamp lights. Some offices may have circuit arrangements which do not furnish key control. In this case, it will be necessary to block coin-trunk-timed-release C relay in the nonoperated position.

1.09 When making the coin-trunk-timed-release circuit (SD-31861-01) effective in an office arranged for extending alarms to another office, operate audible alarm switch or key to position that makes alarms extend to another office. Notify proper person in the distant office that alarms have been transferred. For offices not arranged for extending alarms, at coin-trunk-timed-release circuit (SD-31861-01), turn CO key to a position where GD lamp is extinguished.

2. TEST PROCEDURES

A. Apparatus

Tests A Through ♦G4

- 2.01 Test set J34701A (SD-31858-01).
- 2.02 Head telephone set, 52-type.
- 2.03 Two P3E patching cords, 6 feet long, equipped with red-shelled 310 plugs (3P7A cords).

B. Flowcharts

2.04 Table A provides an explanation of the symbols that are used in the test procedure flowcharts.

TABLE A
FLOW CHART EXPLANATIONS

SYMBOL	EXPLANATION
	Indicates the beginning of the procedure and an exit or entrance reference to pages within same procedure.
	Indicates an action which is performed on a manual or automatic basis.
	Brackets are used to reference supporting-type data.
	Used to represent a decision which determines which one of two paths to take.
	The end of procedure symbol is used to denote that the end of the emergency action condition has been completed.
────	Used to indicate the direction of information flow.
△	Used to indicate two processes flowing into a common sequence.

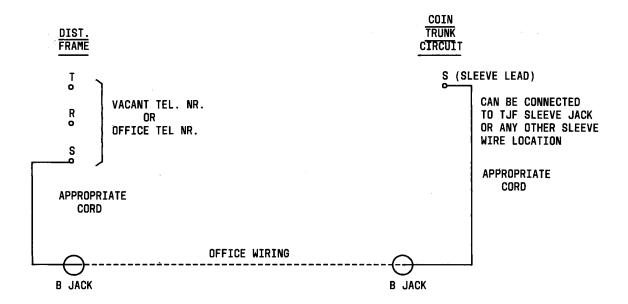


Fig. 1—Example of Connections Needed For Test D When Office Is Equipped With ANI

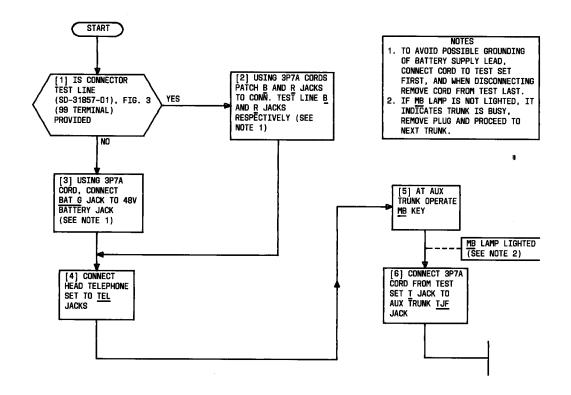


Fig. 2—Test Preparation

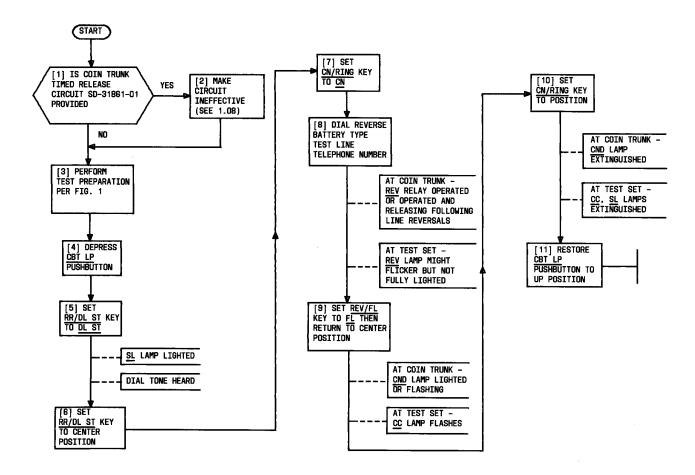


Fig. 3—Test A: Coin Collect—Loop

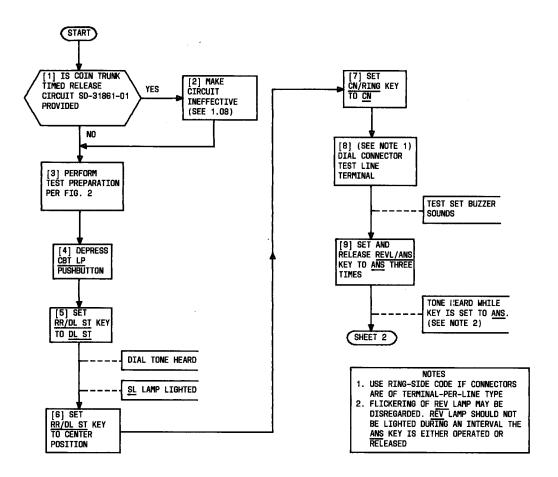


Fig. 4—Test B: Coin Collect—Loop Using Connector Test Line SD-31857-01 Fig. 3 (99 Terminal) (Sheet 1 of 2)

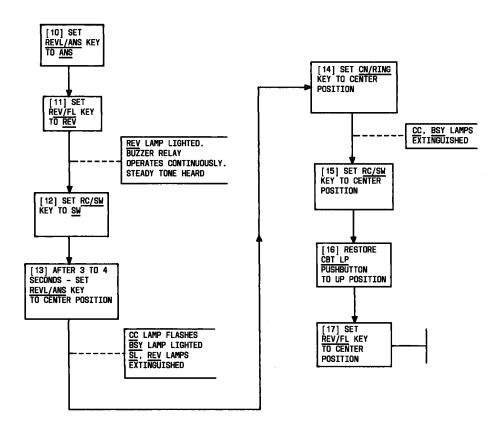


Fig. 4—Test B: Coin Collect—Loop Using Connector Test Line SD-31857-01 Fig. 3 (99 Terminal) (Sheet 2 of 2)

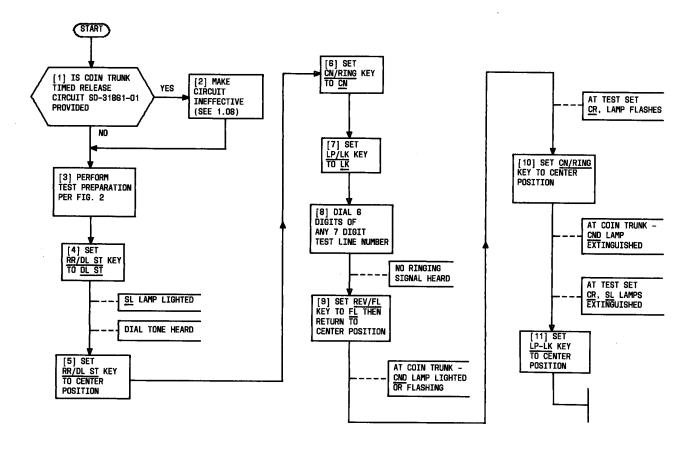


Fig. 5—Test C: Coin Return—Leak

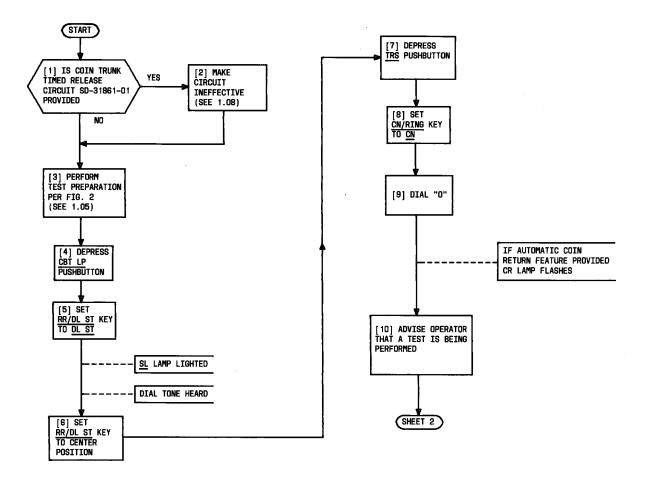


Fig. 6—Test D: Operator Cut-Through and Ringback (Sheet 1 of 2)

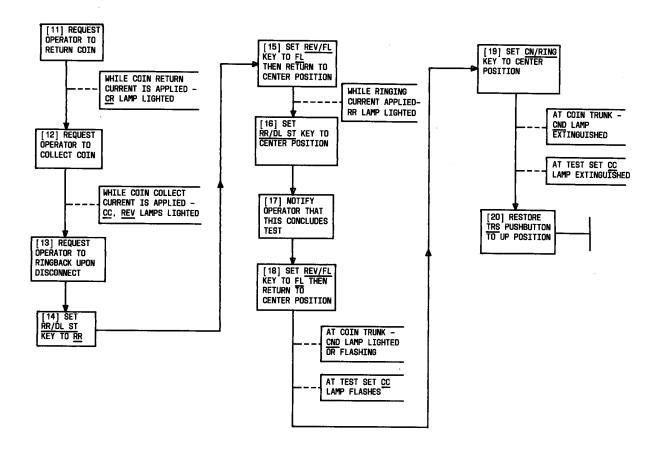


Fig. 6—Test D: Operate Cut-Through and Ringback (Sheet 2 of 2)

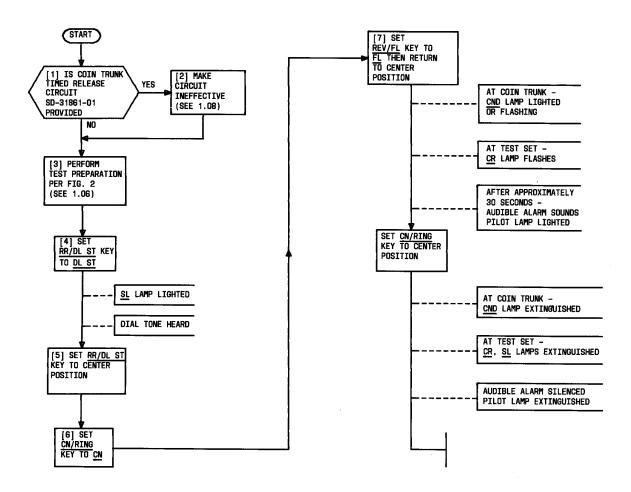


Fig. 7—Test E: Stuck-Coin Alarm Test

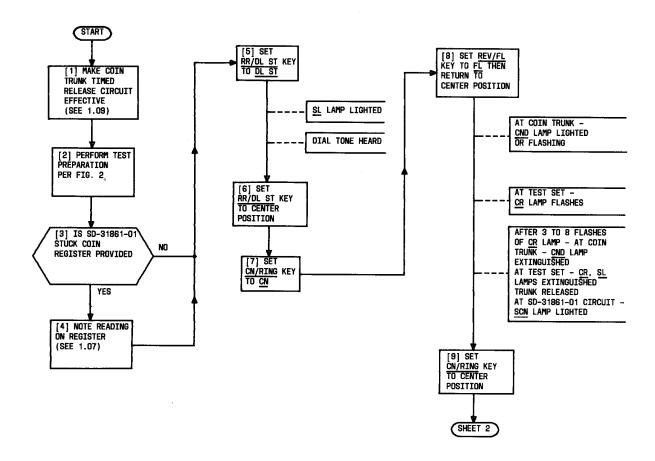


Fig. 8—Test F: Coin-Trunk-Timed-Release Circuit Test (SD-31861-01) (Sheet 1 of 2)

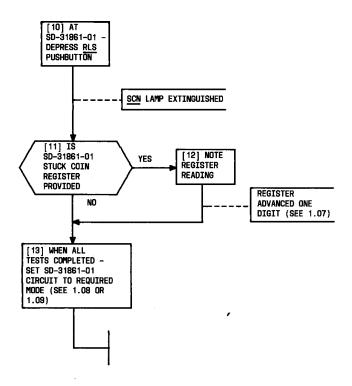


Fig. 8—Test F: Coin-Trunk-Timed-Release Circuit
Test (SD-31861-01) (Sheet 2 of 2)

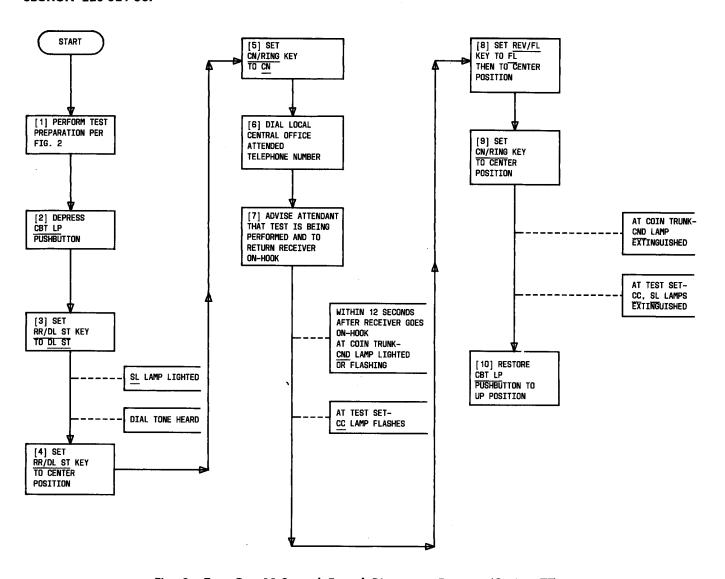


Fig. 9—Test G: 12-Second Forced Disconnect Feature (Option ZF)