


4 STROMBERG-CARLSON CO. 1268 MAGNETO DESK SET BOX USED WITH 1244 DESK SET

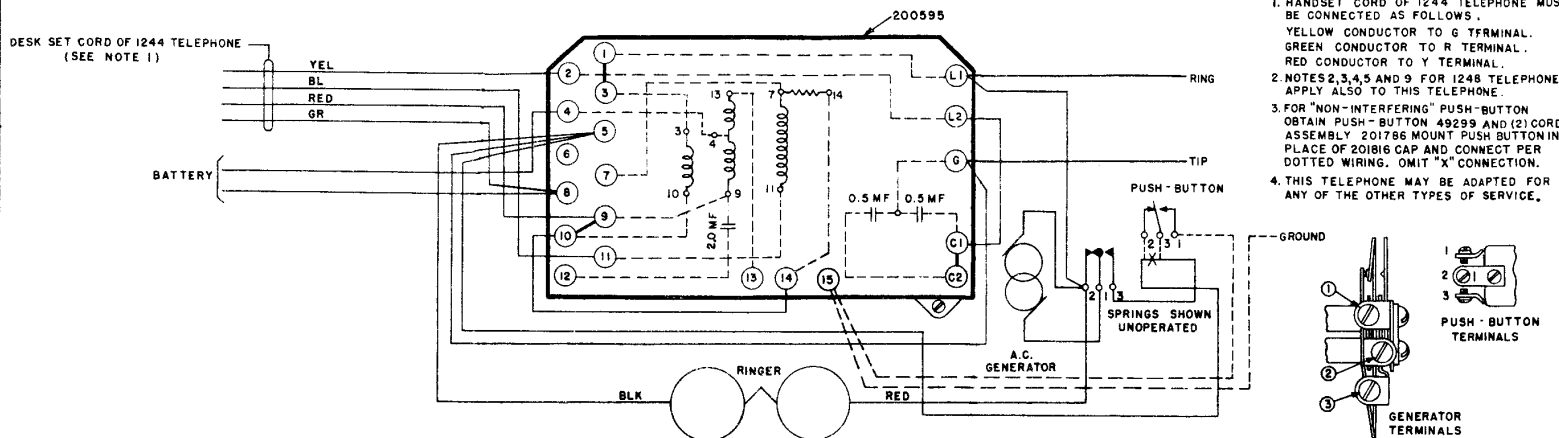

NOTES FOR 1268

1. HANDSET CORD OF 1244 TELEPHONE MUST BE CONNECTED AS FOLLOWS:
YELLOW CONDUCTOR TO G TERMINAL.
GREEN CONDUCTOR TO R TERMINAL.
RED CONDUCTOR TO Y TERMINAL.
2. NOTES 2, 3, 4, 5 AND 9 FOR 1248 TELEPHONE APPLY ALSO TO THIS TELEPHONE.
3. FOR "NON-INTERFERING" PUSH-BUTTON OBTAIN PUSH-BUTTON 49299 AND (2) CORD ASSEMBLY 201786 MOUNT PUSH-BUTTON IN PLACE OF 201816 CAP AND CONNECT PER DOTTED WIRING. OMIT "X" CONNECTION.
4. THIS TELEPHONE MAY BE ADAPTED FOR ANY OF THE OTHER TYPES OF SERVICE.

NOTES FOR 1248 AND 1258

1. YELLOW OF LINE CORD IS NOT TO BE GROUNDED, EXCEPT WHEN NOTE 6 IS USED.
2. FOR REDUCED SIDETONE ON LONG NON-LOADED CABLE LOOPS OMIT STRAP 14 TO 10 AND CONNECT A 20359 ASSEMBLY BETWEEN TERMINALS 7 TO 10.
- 3A. THE CIRCUIT AS SHOWN PLACES 1.MF IN THE TALKING CIRCUIT FOR "SURE-RING" OPERATION.
- 3B. TO INCLUDE THE 1.MF IN THE RINGER CIRCUIT, ALSO, FOR LINE TESTING, MOVE THE BLACK RINGER LEAD FROM 5 TO C2. IN THIS CASE ANY STATION CAN BE RUNG EXCEPT THE ONE WHERE HANDSET IS OFF THE CRADLE.
- 3C. FOR LINE TESTING WITHOUT "SURE-RING" OPERATION CONNECT 1.MF IN THE RINGER CIRCUIT ONLY BY REMOVING STRAP L2 TO C1 AND ADDING A STRAP FROM L2 TO G AND MOVING BLACK RINGER LEAD FROM 5 TO C2.
- 3D. IF NO CAPACITOR IS REQUIRED IN EITHER TALKING OR RINGING CIRCUITS REMOVE STRAP L2 TO C1 AND ADD STRAPS L2 TO G.
4. FOR HARMONIC RINGERS USE CONNECTIONS AS IN 3B OR 3C.
5. FOR "SILENT-RINGER" MOVE RED OF RINGER TO No. 1 TERMINAL OF GENERATOR SWITCH.
6. FOR "NON-INTERFERING" PUSH-BUTTON REPLACE DIAL BLANK WITH 200846 DIAL BLANK, THIS (WITH 2 CONN. WIRES) MAY BE OBTAINED IN PACKAGE ASSEMBLY 209771 CONNECT PER DOTTED WIRING, OMITTING "X" CONNECTIONS.
7. TO USE TWO-STEP HOOKSWITCH OPERATION, BEND TAB ON NAME PLATE LEVER INWARD. NO CIRCUIT CHANGE IS REQUIRED.
8. TO CONVERT TO 1243, REMOVE SUB-BASE AND GENERATOR, REMOUNT 200595 AND RINGER AND REVISE PER CIRCUIT 1, No. 205932. (1248 ONLY)
- TO CONVERT TO 1247, REMOVE SUB-BASE AND GENERATOR, REMOUNT 200595 AND RINGER, ADD INDUCTION COIL 200604 AND REVISE PER CIRCUIT 2, No. 205933. (1248 ONLY) NEW HANDSET CORD REQUIRED.

5 WIRING AND CONNECTIONS FOR BRIDGED RINGING FOR 1248 & 1258 TELEPHONES (MAGNETO)

